

Combination Meter ECU Power Source Circuit

INSPECTION PROCEDURE


- 1 Check fuses. (GAUGE, MPX-B and DOME fuse)

NG

Replace fuse.

OK

- 2 Check voltage between terminals MPX+B and GND of combination meter connector.

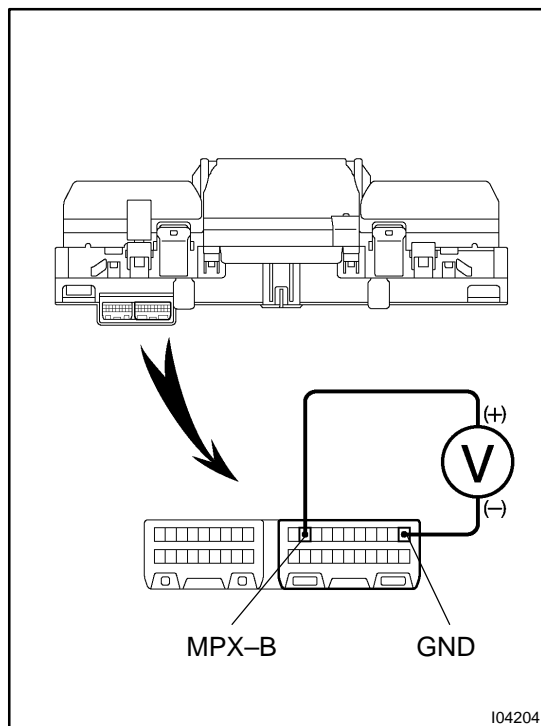

PREPARATION:

- (a) Remove combination meter.
- (b) Disconnect the combination meter connector.

CHECK:

Measure voltage between terminals MPX+B and GND of combination meter connector.

OK:

Voltage: 10 – 14 V

OK

Proceed to next circuit inspection shown in problem symptoms table (See page [DI-898](#)).

NG

3	Check for open in harness and connector between terminal GND of combination meter and body ground (See page IN-32).
---	--

NG

Repair or replace harness or connector.

OK

Check and repair harness and connector between combination meter and battery.