

DTC	B1273 / 73	Sliding roof ECU communication stop (w/ Sliding roof vehicle only)
------------	-------------------	---

CIRCUIT DESCRIPTION

This DTC is output when communication stops between sliding roof ECU and Body ECU No. 1.

DTC No.	DTC Detecting Condition	Trouble Area
B1273/73	No communication from sliding roof ECU more than 10 seconds.	<ul style="list-style-type: none">• Sliding roof ECU• Wireharness

WIRING DIAGRAM

See page [DI-1125](#).

INSPECTION PROCEDURE

1	Check sliding roof ECU.
----------	--------------------------------

CHECK:

Check that the operation of the sliding roof function is normal.

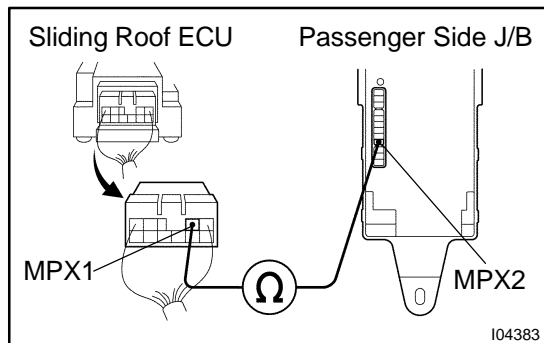
HINT:

With this inspection, the sliding roof ECU CPU can be diagnosed if it works normally or not.

NG

Replace the sliding roof ECU.

OK

2**Check wireharness****PREPARATION:**

Disconnect connector sliding roof ECU and Body ECU No. 1.

HINT:

Connector is disconnected by removing Body ECU No. 1 from passenger side junction block.

CHECK:

Check continuity between terminals MPX2 of Body ECU No. 1 and MPX1 of sliding roof ECU.

OK:

There is a continuity in wireharness.

NG**Repair or replace wireharness.****OK****Replace the sliding roof ECU.**