


# WIRING DIAGRAM

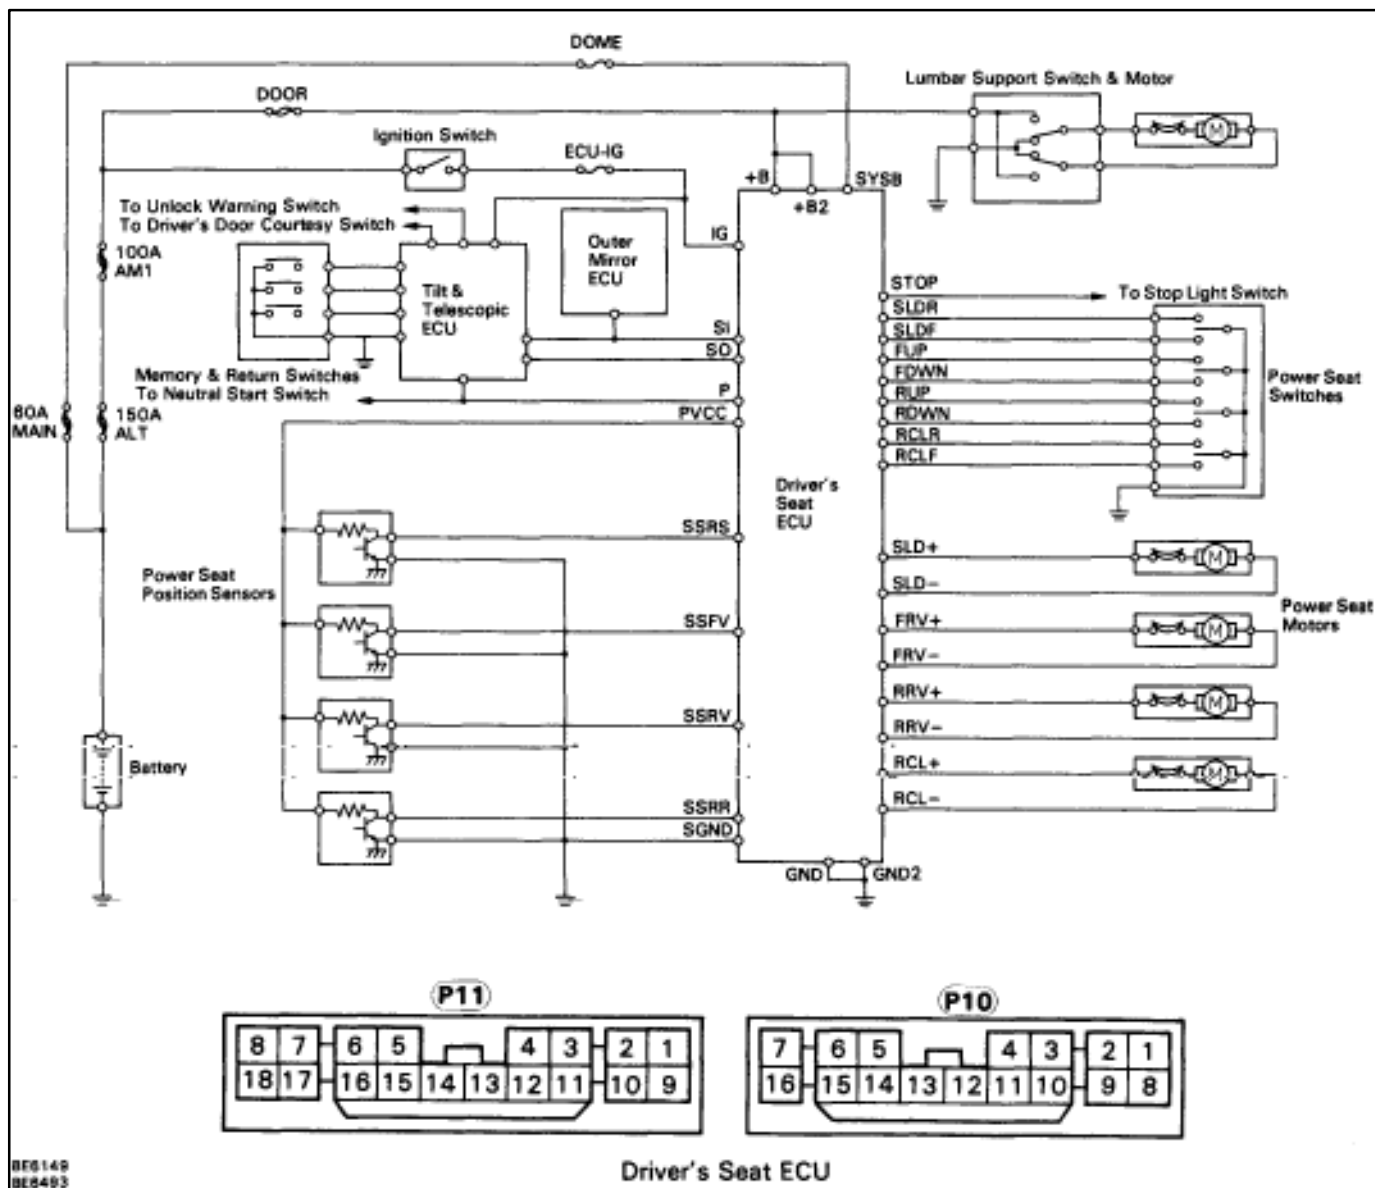

No.	Symbol	Terminal Name	No.	Symbol	Terminal Name	No.	Symbol	Terminal Name
P11-1	SLDF	Slide Switch (Forward)	P11-13	CHK	Check	P10-7	IG	Ignition Switch
2	RCLF	Reclining Switch (Forward)	14	SSRR	Reclining Sensor	8	GND2	Ground 2
3	FUP	Front Vertical Switch (UP)	15	SSRV	Rear Vertical Sensor	9	SLD-	Slide Motor (Back)
4	RUP	Rear Vertical Switch (UP)	16	SSRS	Slide Sensor	10	RCL-	Reclining Motor (Down)
5	SSFV	Front Vertical Switch	17	SO	Serial Communications	11	FRV-	Front Vertical Motor (Down)
6	PVCC	Position Sensor Power Source	18	SGND	Sensor Ground	12	RRV-	Rear Vertical Motor (Down)
7	SYSB	Power Source	P10-1	GND	Ground	13	RRV+	Rear Vertical Motor (Forward)
8	SI	Serial Communications	2	SLD+	Slide Motor (Forward)	14	+B2	Power Source
9	SLDR	Slide Switch (Back)	3	RCL+	Reclining Motor (Up)	15	P	Neutral Start Switch
10	RCLR	Reclining Switch (Back)	4	FRV+	Front Vertical Motor (Up)	16	—	—
11	FDWN	Front Vertical Switch (Down)	5	+B	Power Source			
12	RDWN	Rear Vertical Switch (Down)	6	STOP	Stop Light			